



## **Renault Twingo (X06) From model year 09.1998**

### **Airbag lamp illuminates**

If there are complaints about the above-mentioned fault, the cause could be the airbag control unit. The above mentioned fault may occur due to the sensitivity of the control unit to electromagnetic influences. Therefore, the first thing to do is to ask the customer whether he or she was using a mobile telephone in the car when the control lamp illuminated. If the customer confirms this, the part number of the airbag control unit should be checked. A readout of this can be taken with the aid of a diagnosis tester. If the following part numbers are displayed:

82 00 018 833

82 00 018 835

82 00 111 668,

a special copper adhesive tape must be wrapped around the plug-connection on the airbag control unit. This can be obtained via the vehicle manufacturer. The control unit is located under the panelling of the centre console (in front of the gear lever).

**A:** Airbag control unit

**B:** Copper adhesive tape

**C:** Plug

