

© Hella KGaA Hueck & Co., Lippstadt

18 October 2007

Rover 200 All models

Deactivation of the alarm control system/immobilizer not possible via the remote control.

If there are complaints with these vehicles that the alarm control system/immobilizer cannot be deactivated via the remote control, the following causes should be considered:

The remote control is defective or not programmed.

A poor contact between the control unit of the alarm control system and the wiring-harness plug.

Heavy influencing of the radio signal of the remote control by other radio waves.

In order to eliminate the fault, a check should be made to see if the fault is permanently present or if it occurs only at particular locations. This allows the cause of the fault being other radio waves to be excluded. In order to ensure perfect operation of the remote control, the battery should be checked and correct programming should be ensured using suitable diagnosis equipment. The plug-connection on the control unit of the alarm control system should also be checked.

Bulletin





1-1

HELLA