



Rover 75

ABS warning light comes on

In the case of the above-mentioned vehicles, the ABS warning light can remain on permanently after the engine has been started up. This problem particularly affects vehicles up to chassis no.: RJ 138975. In many cases the fault is caused by water penetrating the ABS control unit.

The capillary affect makes humidity rise through the harness of the front ABS sensors to the ABS unit. To remedy the problem, the connection of the ABS unit and the sensors should be checked for humidity. The front ABS sensors (photo) must be replaced if necessary. Suitable sensors can be found in the Hella electronics range (part no.: 6PU 009 106-351).

