



## Saab 9-3

### Damaged side impact sensor cables.

With these vehicles, the side impact sensor cables mounted in the doors can become damaged.

If the cables are damaged, the airbag system will fail. To eliminate the fault proceed as follows:

- Remove the door lining and door sheeting (waterproof seal).
- Check the cable strand for damage. If the cable strand is damaged, it must be replaced and secured against repeated damage using a second clip (see diagram).
- If there is no damage, the cable must also be fixed in place using a further clip (see diagram).
- Replace the door sheeting and door lining (note: make sure the door sheeting is fitted properly and seals the door, preventing water from penetrating into the passenger compartment).
- Delete fault store.

In the event of a complaint, the cables on the driver side and passenger side should be checked.

