



Saab 9-3 **Up to chassis no.: W2061707,** **X2005838**

Blocked hose on activated carbon filter.

With these vehicles it is possible that the following faults occur:

- Poor engine performance
- Vibrations during acceleration
- Motor stalls during a journey, can be started again without any problem a few hours later
- Tank display is incorrect
- Deformation of the fuel tank

The cause of these faults can be an incorrectly laid, bent hose on the activated carbon filter. The bend causes complete hose blockage and the above-mentioned fault, which will not necessarily immediately be connected with this fault cause. To eliminate the fault, check all the hoses on the activated carbon filter and, if necessary, correct their installation position.

If the fuel tank is deformed, the fuel pump and the tank sensor must also be checked.