



Saab 9-5

Error messages in the SID, function problems with the winter/sport switch.

If there are complaints with these vehicles that e.g. the “Gearing overheated” error message is displayed in the SID (**S**aab **I**nformation **D**isplay) or problems with the winter/sport switch occur, then a possible cause can be a poor earth connection.

In that case, the earthing points G41S and G41P should be checked. The earthing points are located behind the radio. Point G41S on the left side at the centre of the knee protection tie-bar and point G41S on the right side at the centre of the knee protection tie-bar. The earthing cables connected must be tightly connected and not be oxidised.

Bulletin

