



## **Ford Scorpio, model year 09.1994-09.1995**

### **With semi-automatic air conditioning**


#### **Blower motor occasionally fails**

If there are complaints about the above-mentioned fault, the cause could be a faulty blower motor resistor. This occurs due to overheating of the resistor heat sink, and with the air conditioning system switched off.

In this case, a modified resistor must be fitted.

Proceed as follows:

- Remove the connector (1).
- Remove the screws (2).
- Fit a new blower motor resistor.
- Carry out a functional check of the blower motor.

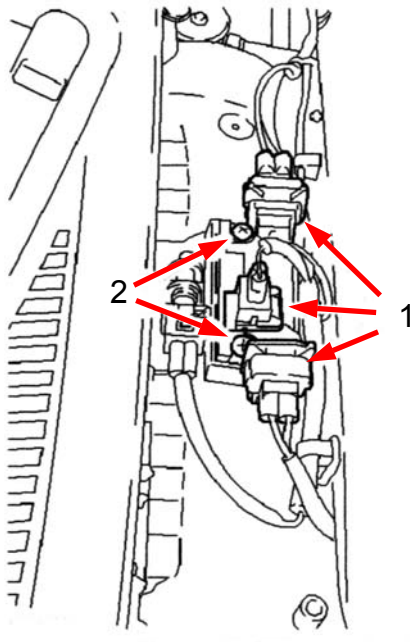

# Bulletin