

© Behr Hella Service GmbH, Schwäbisch Hall



1-1

01. Oktober 2005

Mazda 626 V (GF/GW) Engine: 2.0i 85KW

High-pressure service connection

The high-pressure service connection is attached to the filter/dryer of the above-mentioned vehicles. To save searching, please proceed as follows:

- Remove the fixing plugs (Figure 1, arrow) of the plastic cover (Figure 1, Item A), in the area of the lock support, and dismantle the cover.
- The high-pressure service connection (Figure 2) is now freely accessible.

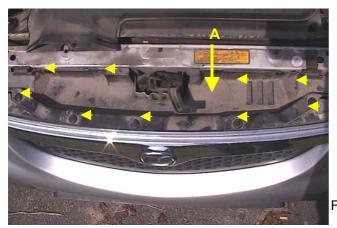


Figure 1





Figure 2