




## **Mazda 2 (B2W)**

### **Changed refrigerant filling quantity**

In the case of the above-mentioned vehicles, the refrigerant filling quantity has changed from model year January 2007 due to a modified condenser. The new refrigerant filling quantity is 470 g. The modified OE condensers of the manufacturer Visteon now have a lower flat-tube cross-section. So that performance is retained with the same matrix dimensions, the number of flat tubes was increased from 32 to 38. As the modified OE or Visteon condensers are now also offered as replacement condensers for vehicles prior to model year 2007, the filling quantity must be adapted accordingly during installation. If *Behr Hella Service* condensers are used (see picture, part no. 8FC 351 300-351), the air-conditioning system should still be filled with the old refrigerant filling quantity of 650 g.

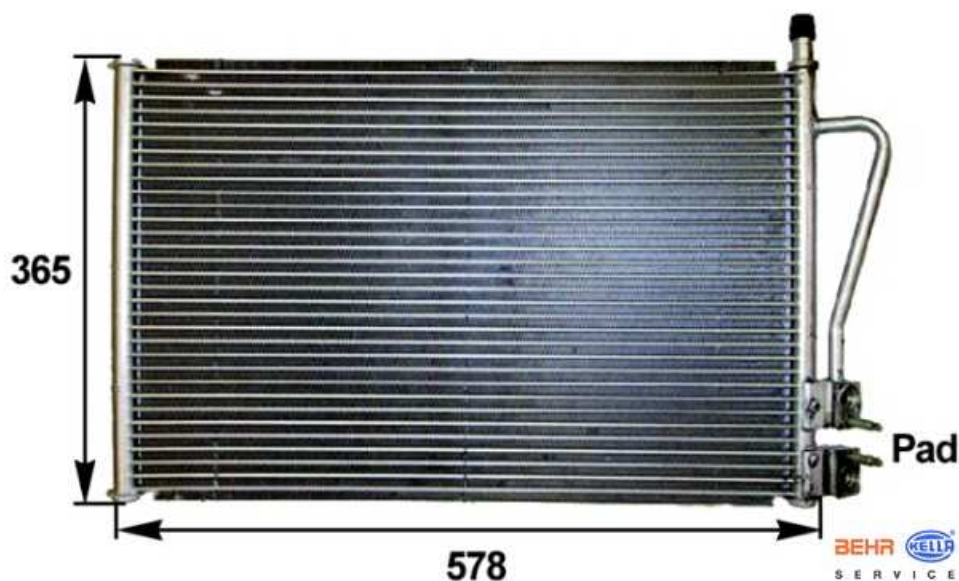

Bulletin