



Opel

Astra G Model year 2003–2004
Zafira Model year 2003–2004
Vectra C Model year 2002–2004
Signum Model year 2002–2004
With engines Y20DTH / Y22DTR

Malfunction of the EGR valve

If there are complaints about the above-mentioned fault, the cause could be faulty contacting. Also, fault code P 0400 (C) and/or fault code P 0400 (9) are/is stored. In addition, the vehicle goes into "limp-home" mode.

In this case, an electrical contact on the EGR valve must be cut through.

Note:

In the case of the Astra G and in the case of the Zafira, the EGR valve must be removed.

To rectify, proceed as follows:

- Cut through the cable (0.5 / grey-black) which leads from slot 4 on the electric EGR valve to connection 19 on the pump valve. Cut through the cable approx. 20 mm behind the plug of the EGR valve (see Fig. 1). In relation to this, on no account may the pump plug be loosened.
- After this, insulate the cable ends in a watertight manner and fasten to the cable loom using insulating tape (see Fig. 2).



- Delete the fault memory and check the operation of the system.

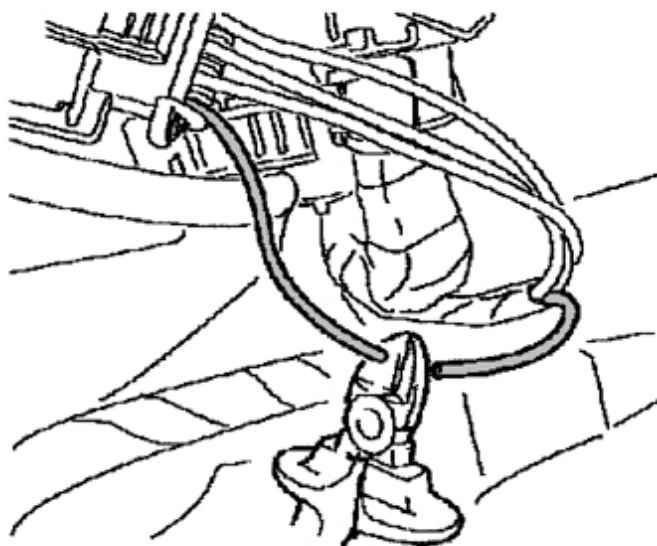


Fig. 1

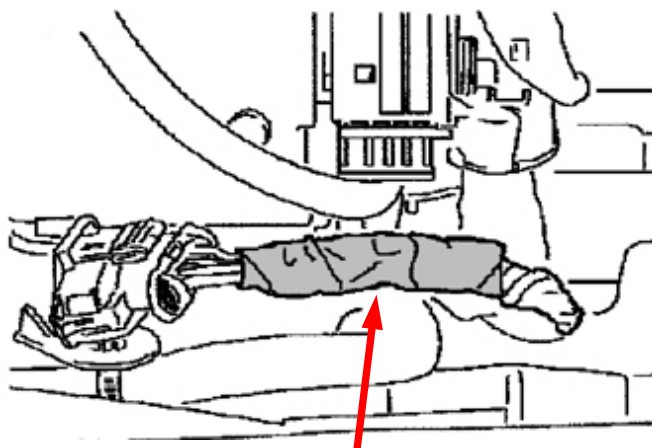


Fig. 2