
Opel Agila From model year 2001 with engine Z10XE, Z12XE

Engine loses power, judders and fault code P0170 is stored.

If there are complaints with these vehicles that the engine judders and the fault code P0170 is stored, one possible cause can be a faulty mass air flow meter. Water vapour that has penetrated the suction system destroys the mass air flow meter. To eliminate the fault the mass air flow meter has to be replaced and an additional seal attached in the bonnet area.

The existing seal must be cut off to match the new seal. The new seal is available from local contractual dealers.

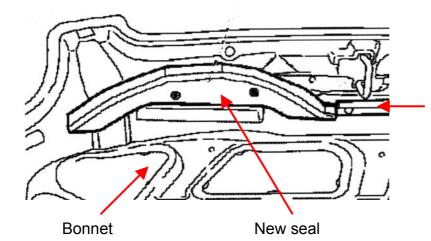

Old seal (cut to match)





1-1